

DTC	P0A37/260	GENERATOR TEMPERATURE SENSOR CIRCUIT RANGE/PERFORMANCE
-----	-----------	---

CIRCUIT DESCRIPTION

Refer to DTC P0A38 (INF 257) on page 05-344.

DTC No.	INF Code	DTC Detection Condition	Trouble Area
P0A37	260	Motor temperature sensor No. 2 performance problem	<ul style="list-style-type: none"> Hybrid vehicle motor Transaxle fluid leakage HV transaxle assembly

INSPECTION PROCEDURE

1	CHECK TRANSAXLE FLUID LEVEL (See page 22-1)
---	---

- (a) Check if the transaxle is filled with fluid to the specified level.

OK: The transaxle is filled with fluid to the specified level

HINT:

The motor temperature sensor No. 2 is unavailable as an individual service part. Therefore, when replacing it, the hybrid vehicle motor must be replaced.

NG

REPAIR OIL LEAKAGE, OR REPLACE HYBRID VEHICLE TRANSAXLE

OK

REPLACE HYBRID VEHICLE MOTOR ASSY
