

M.I.L. "ON" DTC P0AA6 or P3009, Information Codes 526 & 613

Service Category Engine/Hybrid System

Section Hybrid/Battery Control System

Market USA

Toyota Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2004 – 2008	Prius	Plant Code(s): 3, 7

TSB SUPERSESSION NOTICE

The information contained in this TSB supersedes TSB No. EG045-06.

- Applicability has been updated to include 2008 model year vehicles.
- VINs have been updated in the Production Change Information table.
- The Applicable Warranty has been updated in the Warranty Information section.
- TIS Techstream has replaced the Toyota Diagnostic Tester in Required Tools & Materials.

TSB No. EG045-06 is Obsolete and any printed versions should be discarded. Be sure to review the entire content of this service bulletin before proceeding.

Introduction

Some customers with 2004 to 2008 model year Prius vehicles may experience a M.I.L. "ON" condition with DTC P0AA6 or P3009 with information codes 526 and 613. The transaxle assembly has been improved to address this condition.

NOTE

This TSB applies **ONLY** if **BOTH** information codes 526 AND 613 are present.

Production Change Information

This TSB applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PLANT	PRODUCTION CHANGE EFFECTIVE VIN*
Prius	Tsutsumi	JTDKB2#U#8 <u>3</u> 440182
	Toyota Auto Body	JTDKB2#U78 <u>7</u> 800190

* Underlined number in VIN (11th digit) represents assembly plant line code.

M.I.L. "ON" DTC P0AA6 or P3009, Information Codes 526 & 613

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
EG5033	R & R Hybrid Vehicle Transaxle Assembly	5.9	30900-47040	8A	99
Combo A	Connection of TIS Techstream Tester	0.2			

APPLICABLE WARRANTY

- This repair is covered under the Toyota Powertrain Warranty. This warranty is in effect for 60 months or 60,000 miles, whichever occurs first, from the vehicle's in-service date.
- For California specification 2004 – 2008 model year vehicles sold, registered, and operated in California, Connecticut, Maine, Massachusetts, New Hampshire, New Jersey, New York, Oregon, Pennsylvania*, Rhode Island, and Vermont, this repair may be covered, depending on vehicle model year, under the California Emission Warranty, which is in effect for 180 months, or 150,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to correction of a problem based upon a customer's specific complaint.

* In Pennsylvania, California Emission coverage for 2008 model year Prius is 84 months or 70,000 miles.

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
30900-47040	Same	HV Transaxle Assembly	1
00272-SLLC2	Same	Super Long Life Coolant (SLLC)	1
08886-02305	Same	ATF WS	As Needed

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
TIS Techstream** NOTE: Software version 4.00.017 or later is required.	ADE	TSPKG1	1

** Essential SST.

NOTE

Additional TIS Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

M.I.L. "ON" DTC P0AA6 or P3009, Information Codes 526 & 613

Repair Procedure

Remove and replace the hybrid vehicle transaxle assembly.

Refer to the Technical Information System (TIS), applicable model year Prius Repair Manual:

- [2004](#) or [2005](#) Prius:
Drivetrain – Hybrid Transmission/Transaxle – “Hybrid Vehicle Transaxle Assy: Replacement”
- [2006](#) / [2007](#) / [2008](#) Prius:
*Drivetrain – Hybrid Transmission/Transaxle – “Hybrid Transmission/Transaxle: Hybrid Vehicle Transaxle: **Removal**”*
- [2006](#) / [2007](#) / [2008](#) Prius:
*Drivetrain – Hybrid Transmission/Transaxle – “Hybrid Transmission/Transaxle: Hybrid Vehicle Transaxle: **Installation**”*