

# MIL "ON" DTC P3009 or P0AA6, Information Codes 526 & 613

Service  
 Category Engine/Hybrid System

Section Hybrid/Battery Control System

Market USA

Toyota Supports  
 ASE Certification 

## Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2004 – 2008	Prius	Plant Code(s): 3, 7

### TSB REVISION NOTICE

April 22, 2010 Rev1:

- Applicable Warranty has been updated in the Warranty Information section.

Any previous printed versions of this service bulletin should be discarded.

### TSB SUPERSESSION NOTICE

The information contained in this TSB supersedes TSB No. EG045-06.

- Applicability has been updated to include 2008 model year vehicles.
- VINs have been updated in the Production Change Information table.
- The Applicable Warranty has been updated in the Warranty Information section.
- TIS Techstream has replaced the Toyota Diagnostic Tester in Required Tools & Materials.

TSB No. EG045-06 is Obsolete and any printed versions should be discarded. Be sure to review the entire content of this service bulletin before proceeding.

## Introduction

Some 2004 – 2008 model year Prius vehicles may exhibit a MIL "ON" condition with DTC P3009 or P0AA6 with information codes 526 and 613. The transaxle assembly has been improved to address this condition. *defect*

### NOTE

This TSB applies **ONLY** if **BOTH** information codes 526 AND 613 are present.

## MIL "ON" DTC P3009 or P0AA6, Information Codes 526 & 613

### Production Change Information

This TSB applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PLANT	PRODUCTION CHANGE EFFECTIVE VIN*
Prius	Tsutsumi	JTDKB2#U#8 <u>3</u> 440182
	Toyota Auto Body	JTDKB2#U78 <u>7</u> 800190

\* Underlined number in VIN (11th digit) represents assembly plant line code.

### Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
EG5033	R & R Hybrid Vehicle Transaxle Assembly	5.9	30900-47040	8A	99
Combo A	Connection of TIS Techstream Tester	0.2			

#### APPLICABLE WARRANTY

- This repair is covered under the Toyota Powertrain Warranty. This warranty is in effect for 60 months or 60,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

### Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
TIS Techstream* or Techstream Lite  NOTE: Software version 5.00.028 or later is required.	ADE	TSPKG1 or TSLITEDLR01	1

\* Essential SST.

#### NOTE

Additional TIS Techstream or Techstream Lite units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

MIL "ON" DTC P3009 or P0AA6, Information Codes 526 & 613

Parts Information

3465.7 (L)

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
30900-47040	Same	HV Transaxle Assembly	1
00272-SLLC2	Same	Super Long Life Coolant (SLLC)	1
08886-02305	Same	ATF WS	As Needed

Repair Procedure

Remove and replace the hybrid vehicle transaxle assembly.

Refer to the Technical Information System (TIS), applicable model year Prius Repair Manual:

- 2004 / 2005 Prius:  
*Drivetrain – Hybrid Transmission/Transaxle – “Hybrid Vehicle Transaxle Assy: Replacement”*
- 2006 / 2007 / 2008 Prius:  
*Drivetrain – Hybrid Transmission/Transaxle – “Hybrid Transmission/Transaxle: Hybrid Vehicle Transaxle: **Removal**”*
- 2006 / 2007 / 2008 Prius:  
*Drivetrain – Hybrid Transmission/Transaxle – “Hybrid Transmission/Transaxle: Hybrid Vehicle Transaxle: **Installation**”*